

Work Order ID 128710

Friday, August 28, 2015 9:19:26 AM

128710

Page 1

Item ID: D212-664-201TRN Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Crosstube Turning Detail
 Start Date: 1/22/2015 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 1/22/2015 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: ML5 Date: AUG 28 2015 Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-241	Rev E								

100 0.00
 100 MORI SEIKI CNC LATHE LARGE
 Mori Seiki Memo 0.02
 Mori Seiki CNC Lathe Large 1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA114
 2-Turn first side as per Folio FA114
 3-Blend transition lines only, **do not sand whole tube**:
 FOLIO REV: AD
 DWG REV: E
 *Use mill bastard file, brush file repeatedly with file card.
 *Do not use sandpaper coarser than 320 grit.

1 φ
 mm L
 15/09/08

110 0.00
 110 QC1- Inspection performed by CMM
 QC Memo 0.00
 Quality Control

1 φ
 mm L
 15/09/09

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Friday, August 28, 2015 9:19:26 AM

128710

Page 2

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Crosstube Turning Detail

Stop *NS2*

Start Date: 1/22/2015 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 1/22/2015 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

0.03

Mori Seiki

Memo

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA114

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: *AD*

DWG REV: 1/1

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

130

QC1- Inspection performed by CMM

0.00

130

QC

Memo

0.00

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 128710

Friday, August 28, 2015 9:19:26 AM

128710

Page 3

Item ID: D212-664-201TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Turning Detail
Start Date: 1/22/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 1/22/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Date
140	QC8- Inspect parts - second check	0.00				1	0		47
140									9-89
QC	Memo	0.00							
Quality Control								15-09-16	
145		0.00							
145									
Crosstubes	Memo	0.01							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.							15-09-21	
150		0.00							
150									
HandFXtube	Memo	0.01							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

TH 15-09-29
BL

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 128710

Friday, August 28, 2015 9:19:26 AM

128710

Page 4

Item ID: D212-664-201TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 1/22/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/22/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.00

Quality Control

15-9-22

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack

Location: 65 014

BCL 15/09/20

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

SEP 22 2015

MLJ

S.H. 120150622

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : ☐									

Friday, August 28, 2015 9:19:30 AM

128710

D212-664-201TRN

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6006-129		Manufactured	No			120	Each	60.0000	1	1			

D6006-129

Crosstube Material

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG003	42	
103426	2	
107875	18	
107876	21	
75644	1	
SHED	18	
123967	18	

1 man 15/09/08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			


DART AEROSPACE LTD		Work Order: 128710
Description: Crosstube Assembly (205/212 High Aft)		Part Number: D212-664-241
Inspection Dwg: D212-664-241 Rev <i>15-01-22</i>		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	.200	/		vern	CNC-08
	R0.063	+/-0.010	.063	/		R6	
	2.990	+0.005/-0.000	2.990	/		vern	CNC-08
	5.237	+/-0.030	5.237	/			
	2.600	+0.005/-0.000	2.604	/			
	2.686	+0.005/-0.000	2.688	/			
	2.770	+0.005/-0.000	2.772	/			
	2.854	+0.005/-0.000	2.856	/			
	2.938	+0.005/-0.000	2.940	/			
	3.021	+0.005/-0.000	3.024	/			
	3.133	+0.005/-0.000	3.136	/			
	3.179	+0.005/-0.000	3.182	/			
SIDE B	0.200	+/-0.010	.200	/		vern	CNC-08
	R0.063	+/-0.010	.063	/		R6	
	2.990	+0.005/-0.000	2.990	/		vern	CNC-08
	5.237	+/-0.030	5.237	/			
	2.600	+0.005/-0.000	2.601	/			
	2.686	+0.005/-0.000	2.687	/			
	2.770	+0.005/-0.000	2.772	/			
	2.854	+0.005/-0.000	2.855	/			
	2.938	+0.005/-0.000	2.940	/			
	3.021	+0.005/-0.000	3.024	/			
	3.133	+0.005/-0.000	3.135	/			
	3.179	+0.005/-0.000	3.180	/			
	124.362	+/-0.020	124.362	/		tape	L6-11

DART AEROSPACE LTD		Work Order: 128710
Description: Crosstube Assembly (205/212 High Aft)		Part Number: D212-664-241
Inspection Dwg: D212-664-241 Rev: DE		Page 2 of 2

WALL THICKNESS MEASUREMENT

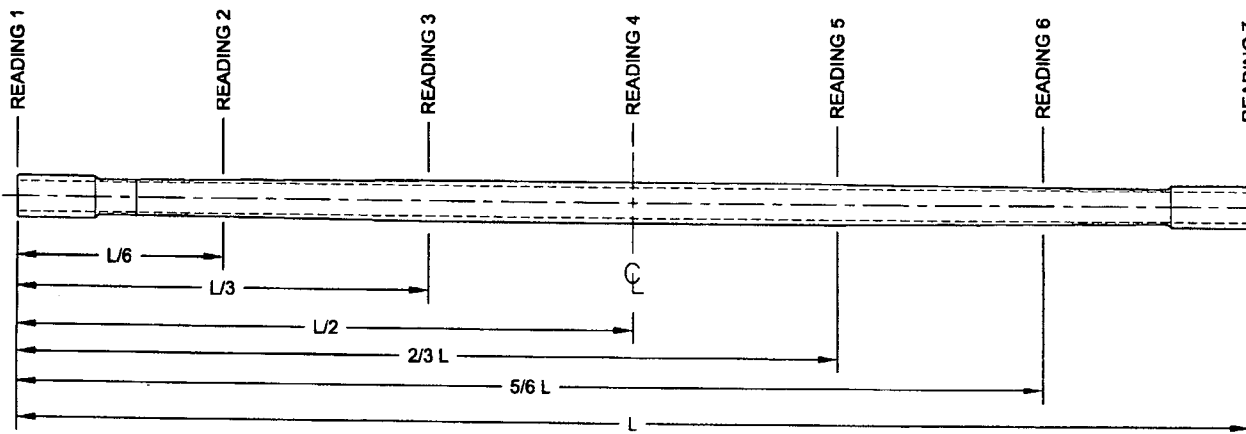

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.392	.390	.386	.391	.007	0.062"
READING 2 L= 21	.310	.328	.316	.299	.029	
READING 3 L= 41	.481	.481	.475	.469	.012	
READING 4 L= 62	.524	.519	.508	.512	.055	
READING 5 L= 89	.489	.485	.477	.476	.013	
READING 6 L= 103	.322	.335	.317	.301	.034	
READING 7 L= 124	.397	.381	.394	.402	.021	

Calibration Result

Actual Block Thickness: 100.250

Sitescan 250 Measured Thickness: 100.350

DAS
47

Measured by: <i>span 6</i>	Audited by: 9-89	Preliminary Approval:
Date: 15/09/11	Date: 15-09-16	Date:

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-201)	KJ/JLM	
B	06.03.09	Tolerance for 5.237 was +/-0.001	KJ/JLM	
C	07.05.08	Dwg Rev. updated	KJ/JLM	
D	10.08.03	Dimension 124.362 was 124.36	KJ	
E	12.06.04	Wall thickness form added	KJ	<i>[Signature]</i>

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2		D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6		2	D5018-1	SUPPORT
7	4	4	MS21920-28	CLAMP (OR MS21920-30)
8	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.382±0.020
- FINISH: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER 'D212-664-XXX' AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: D212-664-241/-241B = 44.2 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY


- INSTALL D2940-1 / D5018-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

RELEASED
2014-05-26

E	D5018-1 WAS D2940-1 (-241B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (ZN B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-4), INCORP DEO D-1/-2	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	q	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	q		
CHECKED	DW	DRAWING NO.	REV. E
MFG. APPR.	J	D212-664-241	SHEET 1 OF 5
APPROVED	J	TITLE	SCALE
DE APPR.	J	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

8 7 6 5 4 3 2 1

13 14 15
 D2940-1 SUPPORT
 MS21920-28 CLAMP, 2X
 D3595-063-530 RUBBER CUSHION, 2X
 2 PL

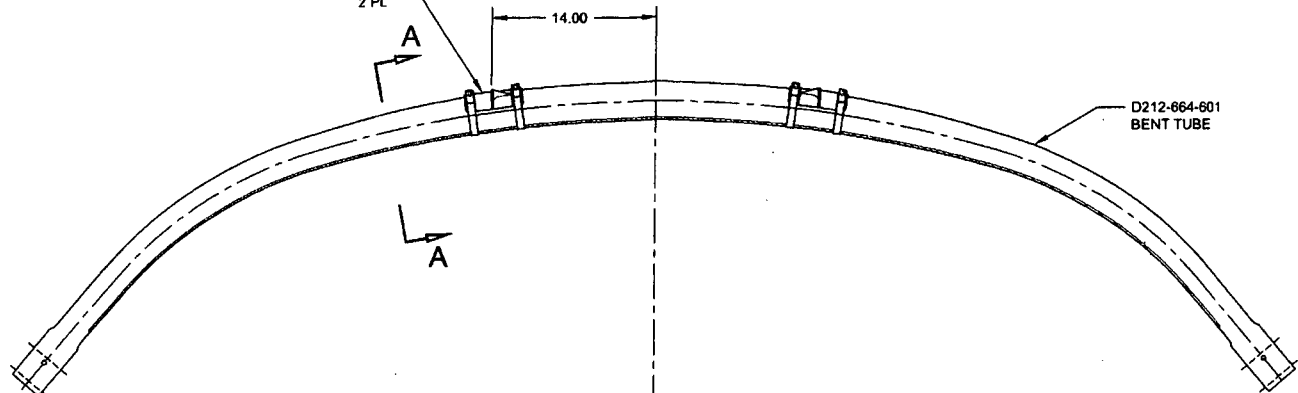

MASK AREA PRIOR TO PAINTING,
 REMOVE MASKING AFTER PAINT
 AND APPLY CLEAR COAT




C
 SYM

**D212-664-241
 ASSEMBLY DETAIL**

E MS21920-28
 CLAMP, REF
 14 15

E 13
 APPLY PROSEAL
 BETWEEN D2940-1 AND
 CROSSTUBE

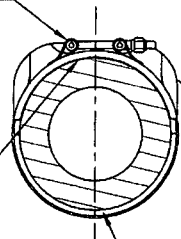

D2940-1
 SUPPORT, REF


D3595-063-530 RUBBER CUSHION
 UNDER CLAMP, REF


**SECTION A-A
 SCALE 4X**

RELEASED
 2014-05-26


DESIGN	9P	DART AEROSPACE LTD	
DRAWN	9P	HAWKESBURY, ONTARIO, CANADA	
CHECKED	SW	DRAWING NO.	REV. E
MFG. APPR.	NS	D212-664-241	SHEET 2 OF 5
APPROVED	NS	TITLE	SCALE
DE APPR.	NS	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

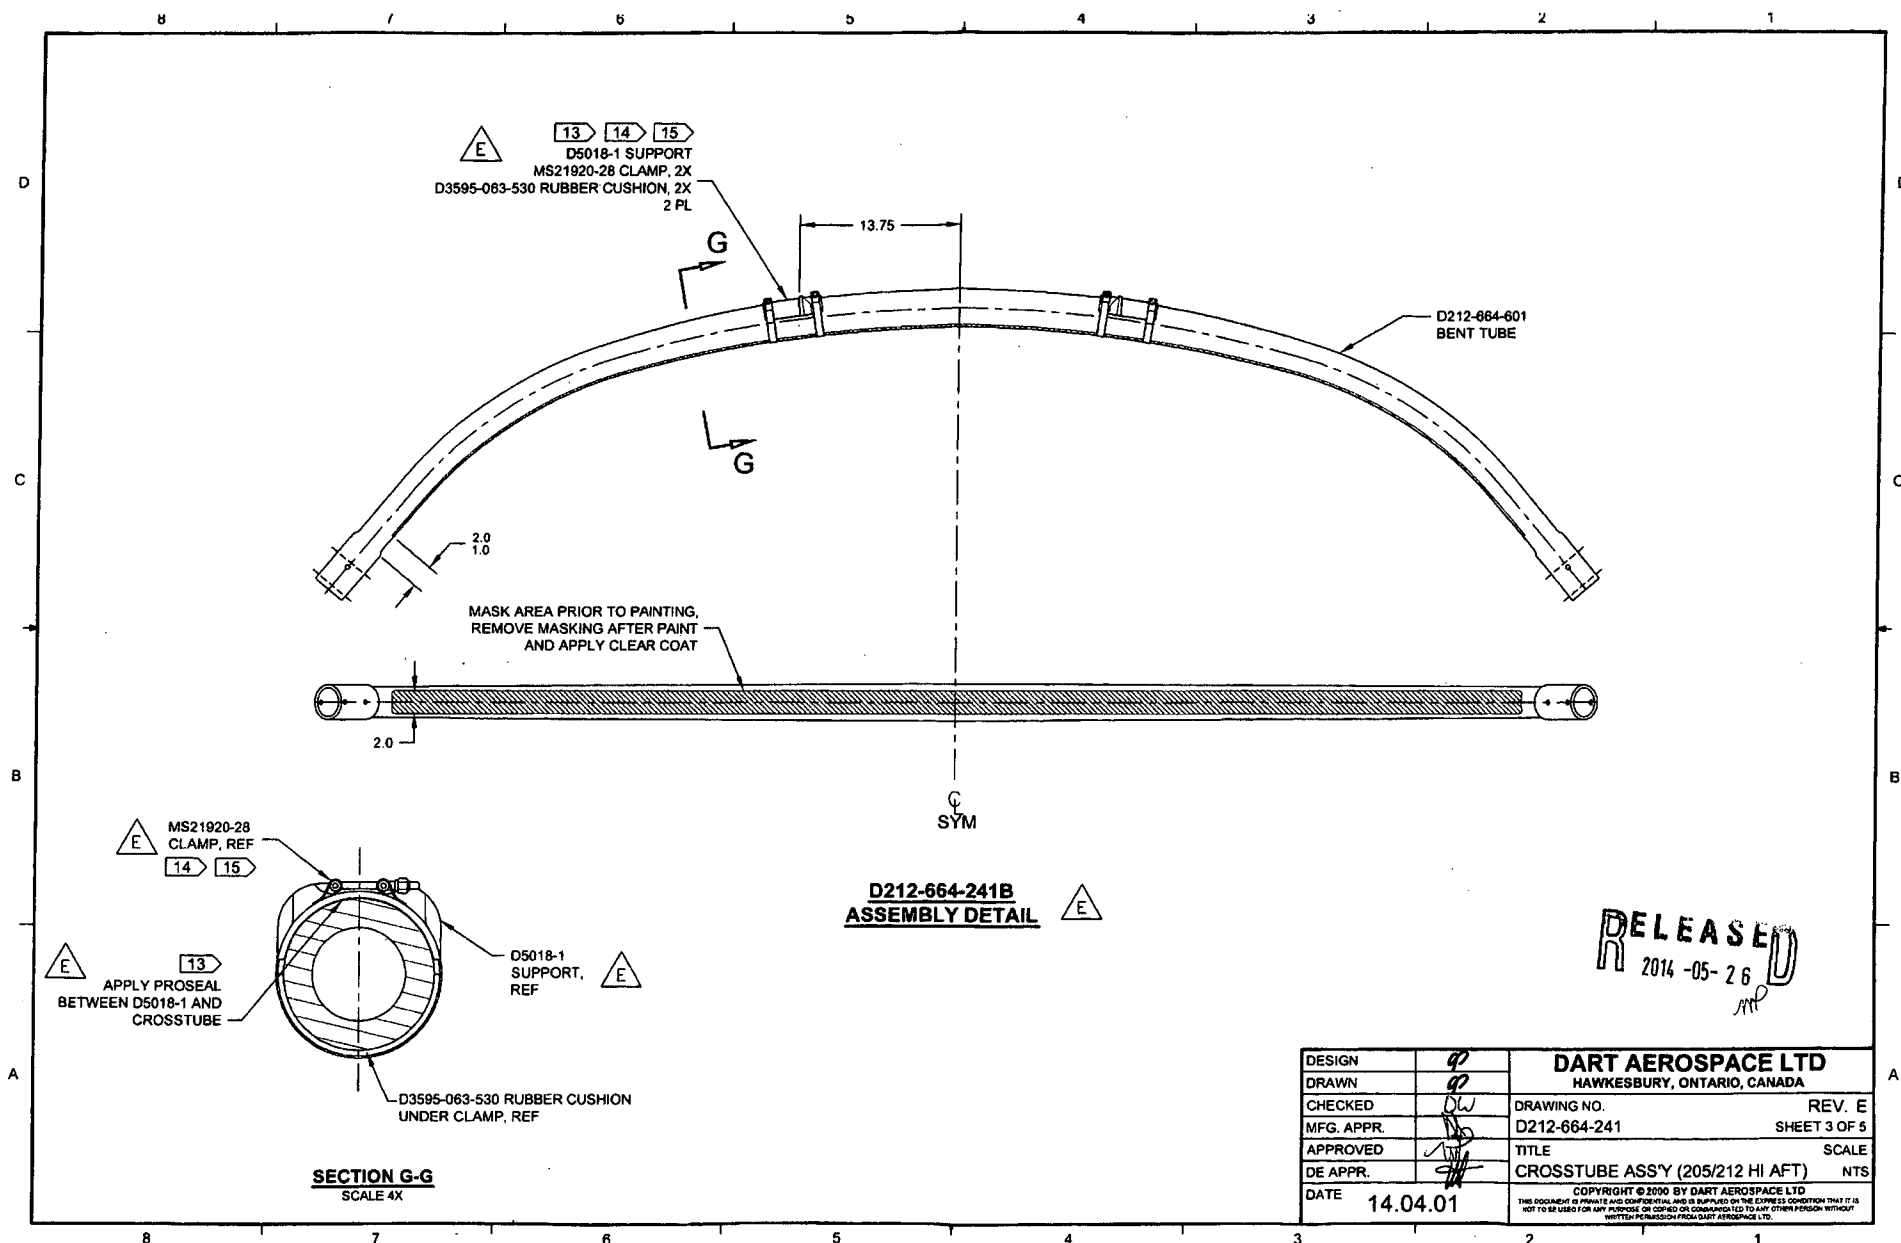


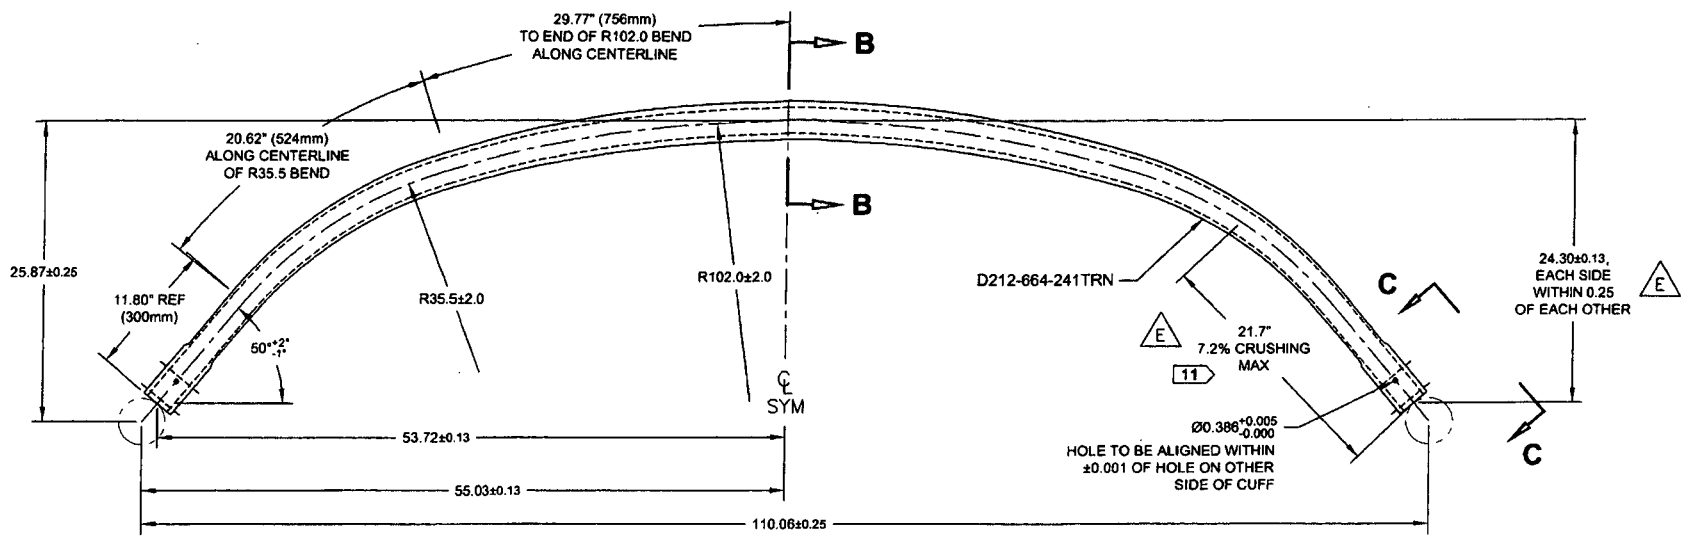

D212-664-601 11
BENDING AND DRILLING DETAIL

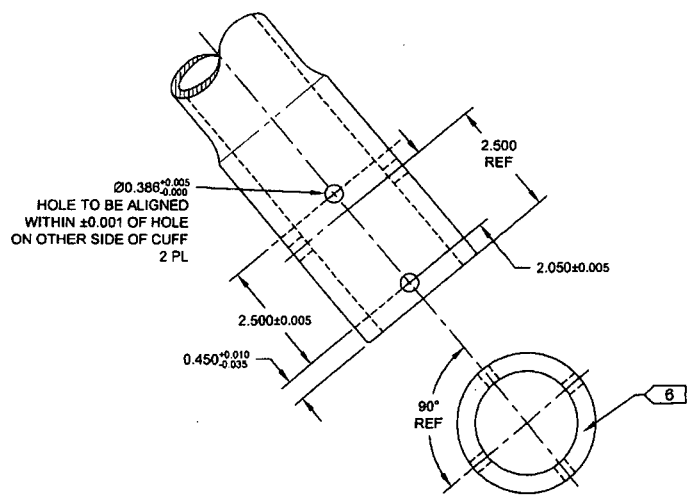

VIEW C-C: CUFF DETAIL
 SCALE 3X

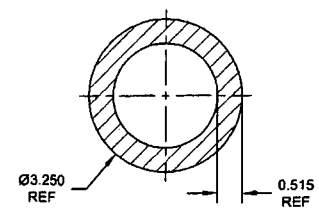

SECTION B-B
 SCALE 4X

RELEASED
 2014-05-26
 JND

DESIGN	<i>Q</i>	DART AEROSPACE LTD	
DRAWN	<i>Q</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>DW</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>[Signature]</i>	D212-664-241	SHEET 4 OF 5
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

0.515 WALL
STOCK, REF

SEE DETAIL D

0.000
2.600^{+0.005}_{-0.000}

2.686^{+0.005}_{-0.000}

2.770^{+0.005}_{-0.000}

2.854^{+0.005}_{-0.000}

2.938^{+0.005}_{-0.000}

3.021^{+0.005}_{-0.000}

3.105^{+0.005}_{-0.000}

3.189^{+0.005}_{-0.000}

3.273^{+0.005}_{-0.000}

3.357^{+0.005}_{-0.000}

3.441^{+0.005}_{-0.000}

3.525^{+0.005}_{-0.000}

3.609^{+0.005}_{-0.000}

3.693^{+0.005}_{-0.000}

3.777^{+0.005}_{-0.000}

3.861^{+0.005}_{-0.000}

3.945^{+0.005}_{-0.000}

4.029^{+0.005}_{-0.000}

4.113^{+0.005}_{-0.000}

4.197^{+0.005}_{-0.000}

4.281^{+0.005}_{-0.000}

4.365^{+0.005}_{-0.000}

4.449^{+0.005}_{-0.000}

4.533^{+0.005}_{-0.000}

4.617^{+0.005}_{-0.000}

4.701^{+0.005}_{-0.000}

4.785^{+0.005}_{-0.000}

4.869^{+0.005}_{-0.000}


4.953^{+0.005}_{-0.000}

5.037^{+0.005}_{-0.000}


SEE DETAIL E

TAPER UNIFORMLY FROM
THROUGH TO 3.276^{+0.005}_{-0.000}
RUNNING OFF PART

D212-664-241TRN
TURNING DETAIL

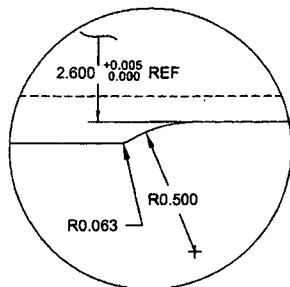

DETAIL F:
CUFF TRANSITION
SCALE 10X

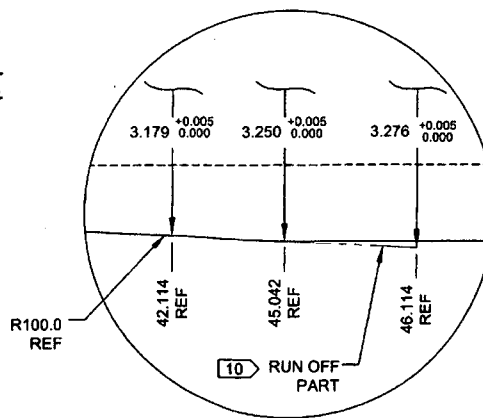

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

10
30° X 0.500 DEEP
CHAMFER

R0.063

SEE DETAIL F

DETAIL D:
CROSSTUBE CUFF
SCALE 5X

RELEASED
2014-05-26

DESIGN	92	DART AEROSPACE LTD	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. E
MFG. APPR.		D212-664-241	SHEET 5 OF 5
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPILED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			